Ultrasonic
Diffuse, Analogue and Digital Output
Types UA30CAD60....TI

CARLO GAVAZZI



- **Cylindrical M30 with Ø40 front and PBT housing**
- **Sensing distance: 350-6000 mm**
- **Power supply: 12 (15) to 30 VDC**
- **Outputs: 0-10 VDC or 4-20 mA and one switching output NPN or PNP.**
- **Linearity error 1%**
- **Repeatability 1%**
- **Beam angle. ±7°**
- **Protection: Short-circuit, reverse polarity and overvoltage**
- **Protection degree IP 67, Nema 4X**
- **2 m cable or M12 plug**

Product Description

A family of diffuse ultrasonic sensors with sensing ranges from 350-6000 mm with a resolution as low as 15 mm. The sensor contains both an analogue and a digital output. The output is either 0-10V or 4-20 mA and the digital output NPN or PNP, NO or NC which forms a windows detection. The sensor is the ideal choice for distance measurement, level measurement, diameter measurement or loop control. Due to use of microprocessor control the digital filtering makes the sensor immune to most electromagnetic interferences.

Ordering Key

UA30CAD60NGM1TI

- **Ultrasonic sensor**
- **Housing style**
- **Housing size**
- **Housing material**
- **Housing length**
- **Detection principle**
- **Sensing distance**
- **Output type**
- **Output configuration**
- **Connection**
- **Teach-in**

Type Selection

Housing diameter	Connection	Rated operating dist. (S_n)	Analog Output	Digital output NPN/PNP	Ordering no.
M30	Plug M12	350-6000 mm	4-20 mA	NPN	**UA 30 CAD 60 NG M1 TI**
M30	Cable	350-6000 mm	4-20 mA	NPN	**UA 30 CAD 60 NG TI**
M30	Plug M12	350-6000 mm	0-10 V	NPN	**UA 30 CAD 60 NK M1 TI**
M30	Cable	350-6000 mm	0-10 V	NPN	**UA 30 CAD 60 NK TI**
M30	Plug M12	350-6000 mm	4-20 mA	PNP	**UA 30 CAD 60 PG M1 TI**
M30	Cable	350-6000 mm	4-20 mA	PNP	**UA 30 CAD 60 PG TI**
M30	Plug M12	350-6000 mm	0-10 V	PNP	**UA 30 CAD 60 PK M1 TI**
M30	Cable	350-6000 mm	0-10 V	PNP	**UA 30 CAD 60 PK TI**

Specifications

Rated operating distance (S_n)	Reference target: 1 mm metal rolled finish, size 200 x 200 mm 350 - 6000 mm
Blind zone	≤ 350 mm
Repeatability	1%
Linear Accuracy	1%
Beam angle	±7°
Sensitivity	
Push-button	P1 (longest setpoint) P2 (shortest setpoint)
Resolution	2 mm
Temperature drift	±5%
Temperature compensation	Yes
Hysteresis (H)	Min. 2.0%

Rated operational voltage (U_B)	
NG or PG versions	12 to 30 VDC
NK or PK versions	15 to 30 VDC (ripple included)
Ripple (U_{rpp})	≤ 5%
No-load supply current (I_o)	50 mA @ U_B max
Output current continuous digital output (I_e)	
Max. load capacity 100 nF	300 mA
Output current short-time digital output (I)	
Max. load capacity 100 nF	300 mA
Minimum operational current digital output (I_m)	0.5 mA
OFF-state current digital output (I_r)	10 µA

ООО «Сенсорен Электро» +7(495)150-48-00 info@sensoren.ru

Sensoren


CARLO GAVAZZI

Specifications (cont.)


Voltage drop digital output (U_d)	≤ 2.2 VDC @ 100 mA
Protection	
Digital output	Short-circuit, overvoltage pulses and reverse polarity
Supply	Overvoltage pulses and reverse polarity
Analogue output	Overvoltage pulses
Analog output	
NG.. or PG.. types	4 to 20 mA
NK.. or PK.. types	0 to 10 VDC
Load	
4 to 20 mA	max. 500 Ω
0 to 10 VDC	min. 3 kΩ
Carrier frequency	75 kHz
Operating frequency digital output (f)	≤ 1 Hz
Response time OFF-ON digital output (t_{ON})	≤ 500 mS
Response time ON-OFF digital output (t_{OFF})	≤ 500 mS
Response time analog output	≤ 500 mS
Power ON delay	≤ 300 mS
Output function, open collector	
By sensor type	NPN or PNP
Output switching function	One open collector transistor and one analogue output to be configured as: - Windows function with N.O or N.C. output. - Analogue output with positive or negative slope.
Indication	
Output ON	Yellow LED
Echo received	Green LED

Environment	
Installation category	III (IEC 60664/60664A; 60947-1)
Pollution degree	3 (IEC 60664/60664A; 60947-1)
Degree of protection	IP67 (IEC 60529; 60947-1) Nema 4X
Ambient temperature	
Operating	-20° to +70°C (-4° to +158°F)
Storage	-35° to +70°C (-31° to +158°F)
Vibration	10 to 55 Hz, 1.0 mm/6G. (IEC/EN 60068-2-6)
Shock	30 g / 11 mS, 3 directions (IEC/EN 60068-2-27)
Rated insulation voltage	< 500 VAC (rms)
Housing	
Material body	PBT
Material front	Epoxy-glass resin
Material back, plug	Grilamid
Material back, cable	Grilamid
Material push-button	TPE
Sealing around push-button	TPE
Material sealing front	TPE
Connection	
Cable	PVC, grey, 2 m, 4 x 0.34 mm², Ø = 4.7 mm
Plug	M12, 4-pin (CON. 14-series)
Tightening torque	≤ 1.5 Nm
Weight	
Cable version	200 g
Plug version	130 g
CE-marking	Yes
Approvals	cULus (UL508)

Wiring Diagram

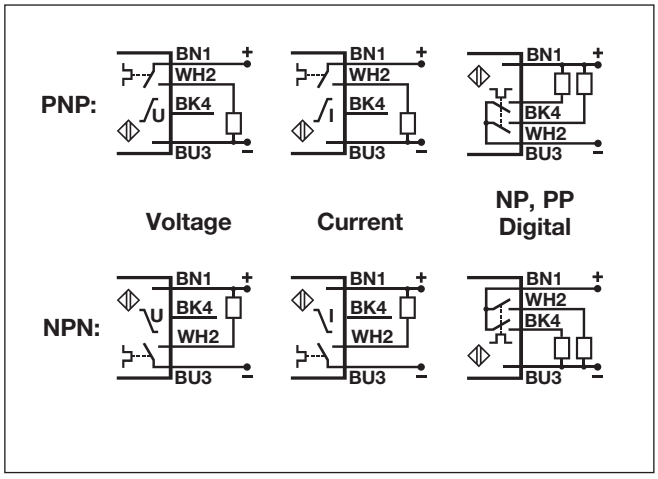

Detection Range

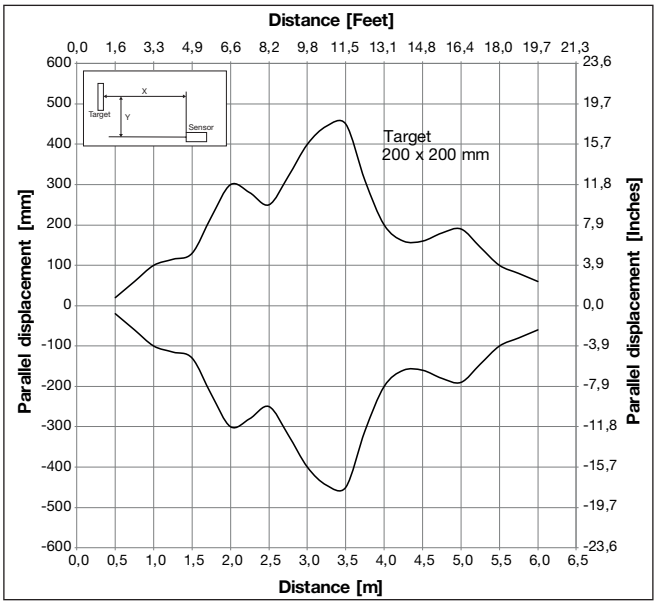


ООО «Сенсорен Электро» +7(495)150-48-00 info@sensoren.ru

Sensoren

CARLO GAVAZZI

Dimensions

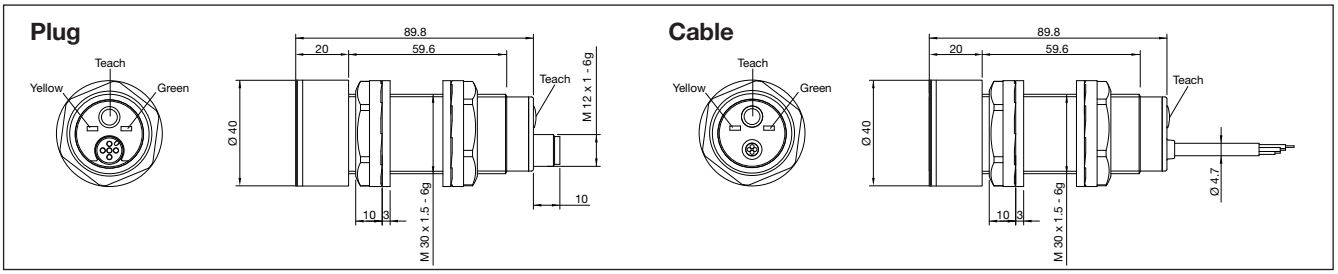

Programming setup

General set up of sensing point P1 (longest distance) and Shortest distance (P2) independent of the sensor type or function.


1) Mount the sensor in the selected application
2) Place a target in front of the sensor at the maximum required distance (P1), then press shortly on the teach-button, the Yellow LED switch Off and then On and start flashing. The distance (P1) is now saved in the sensor, and the target can be moved. I)
3) Place the target at the minimum distance requested (P2), then press shortly on the teach-button. The yellow LED turns Off and then it flashes 5 times. The distance (P2) is now saved in the sensor and the target can be moved. II)

   I) P1 can be set to a maximum exceeding the family specification for the sensor by removing the target in front of the sensor. Push and hold the teach-button more than one second and the sensing distance is set at a unique distance for this sensor only. Do not use this function for an analogue output.


   II) The second switch point can be set to a minimum by placing the target within the blind zone close to the sensor head or by covering the sensor head with your hand while teaching P2.

Sensors with one digital output and one analogue output UA..CAD..PG/PK/NG or NK types

1) The factory setting is Normally Open (N.O.) for the digital output and positive slope for the analogue output.

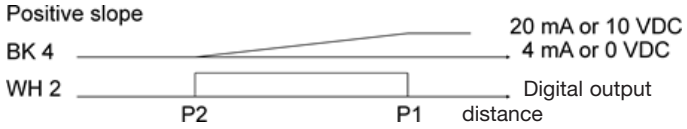





2) To reverse the slope to negative and reverse the N.O. output to Normally Closed (N.C.), push the teach-button for 8 seconds until the yellow LED flashes fast. Release the teach button and the LED will flash 5 times to acknowledge the change in function.

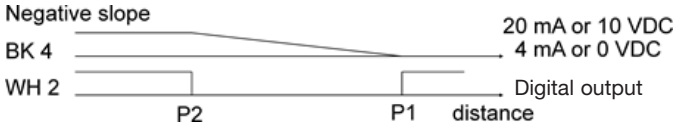

3) To switch back to positive slope or N.O. output, repeat step 2.

ООО «Сенсорен Электро» +7(495)150-48-00 info@sensoren.ru
Sensoren

Installation Hints

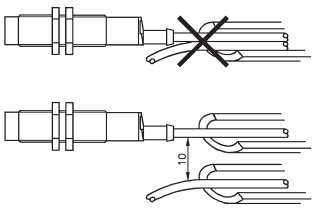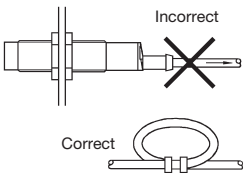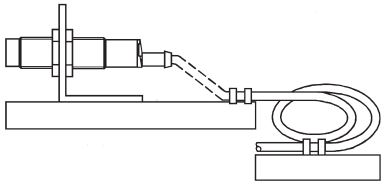To avoid interference from inductive voltage/ current peaks, separate the prox. switch power cables from any other power cables, e.g. motor, contactor or solenoid cables	*Relief of cable strain*	*Protection of the sensing face*	*Switch mounted on mobile carrier*
	 The cable should not be pulled	 A proximity switch should not serve as mechanical stop	 Any repetitive flexing of the cable should be avoided

Delivery Contents

- Ultrasonic sensor: UA30CAD60..
- Installation instruction
- Mounting:
  2 x M30 Nuts
  2 x rubber washers
- Packaging: Carton box 54 x 107 x 173 mm

Accessories

- Connector type CONB14NF.. series

ООО «Сенсорен Электро» +7(495)150-48-00 info@sensoren.ru